


TABLE CONNECTIONS FOR VARIOUS POWER SUPPLIES			
ARRGT.	POWER SUPPLY FOR MOTOR	D.C. FOR LOCAL CIRCUITS TO LINE RELAY AND SELECTOR MAGNETS.	POWER CONNECTIONS
1	110 V. A.C. 50-60 CYCLES	RECT. CONTROL BY PTR. MTR. SWITCH	AS SHOWN
2	110 V. A.C. 50-60 CYCLES	RECTIFIER "ON" CONTINUOUSLY FOR UPPER CASE "H" OR "M" MOTOR CONTROL.	REMOVE WIRE FROM TERM. 3 ON RECEPTACLE "B" AND CONNECT TO TERM. 1.
3	110 V. A.C. 50-60 CYCLES	110 V. D.C. POWER SUPPLY EXTERNAL TO TABLE (EITHER + OR - GROUNDED)	CONNECT A.C. TO RECEPTACLE "B" AS SHOWN. REMOVE WIRES FROM + AND - TERMINALS ON RECEPTACLE "D" AND TAPE ENDS. CONNECT + AND - 110 V. D.C. TO CORRESPONDING TERMS. OF RECEPTACLE "C".
4	110 V. A.C. 25 CYCLES	RECTIFIER CONTROL BY PTR. MTR. SWITCH.	SAME AS ARRGRT. 1 ABOVE EXCEPT ADD 99971 RESISTOR AS SPECIFIED IN NOTE "A" BELOW.
5	110 V. A.C. 25 CYCLES	RECTIFIER "ON" CONTINUOUSLY FOR UPPER CASE "H" OR "M" MOTOR CONTROL.	SAME AS ARRGRT. 2 ABOVE EXCEPT ADD 99971 RESISTOR AS SPECIFIED IN NOTE "A" BELOW.
6	110 V. A.C. 25 CYCLES	110 V. D.C. POWER SUPPLY EXTERNAL TO TABLE (EITHER + OR - GROUNDED)	SAME AS ARRGRT. 3 ABOVE EXCEPT ADD 99971 RESISTOR AS SPECIFIED IN NOTE "A" BELOW.
7	110 V.D.C. POWER SUPPLY EXTERNAL TO TABLE (+ GROUNDED)		95050 CORD NOT USED. STRAP PTR. TERMS. 22 & 25. STRAP PTR. TERMS. 23 & 24.
8	110 V.D.C. POWER SUPPLY EXTERNAL TO TABLE (- GROUNDED)		95050 CORD NOT USED. STRAP PTR. TERMS. 22 & 24. STRAP PTR. TERMS. 23 & 25.

RTTY ELECTRONICS
TELETYPE=Sales-Service-Parts
PO Box 20101 El Sobrante, Ca.
94820. (510)222-3102
mr_rtty@pacbell.net

NOTES:

A. REMOVE AND DISCARD THE STRAP CONNECTED BETWEEN THE UPPER TERMINAL OF RECEPTACLE "A" AND TERMINAL #2 OF RECEPTACLE "B". REMOVE GROUND LEAD FROM THE LATTER TERMINAL. CONNECT A LEAD FROM 99971 RESISTOR TO TERMINAL #2 OF RECEPTACLE "B", AND CONNECT OTHER RESISTOR LEAD AND GROUND LEAD TO UPPER TERMINAL OF RECEPTACLE "A".

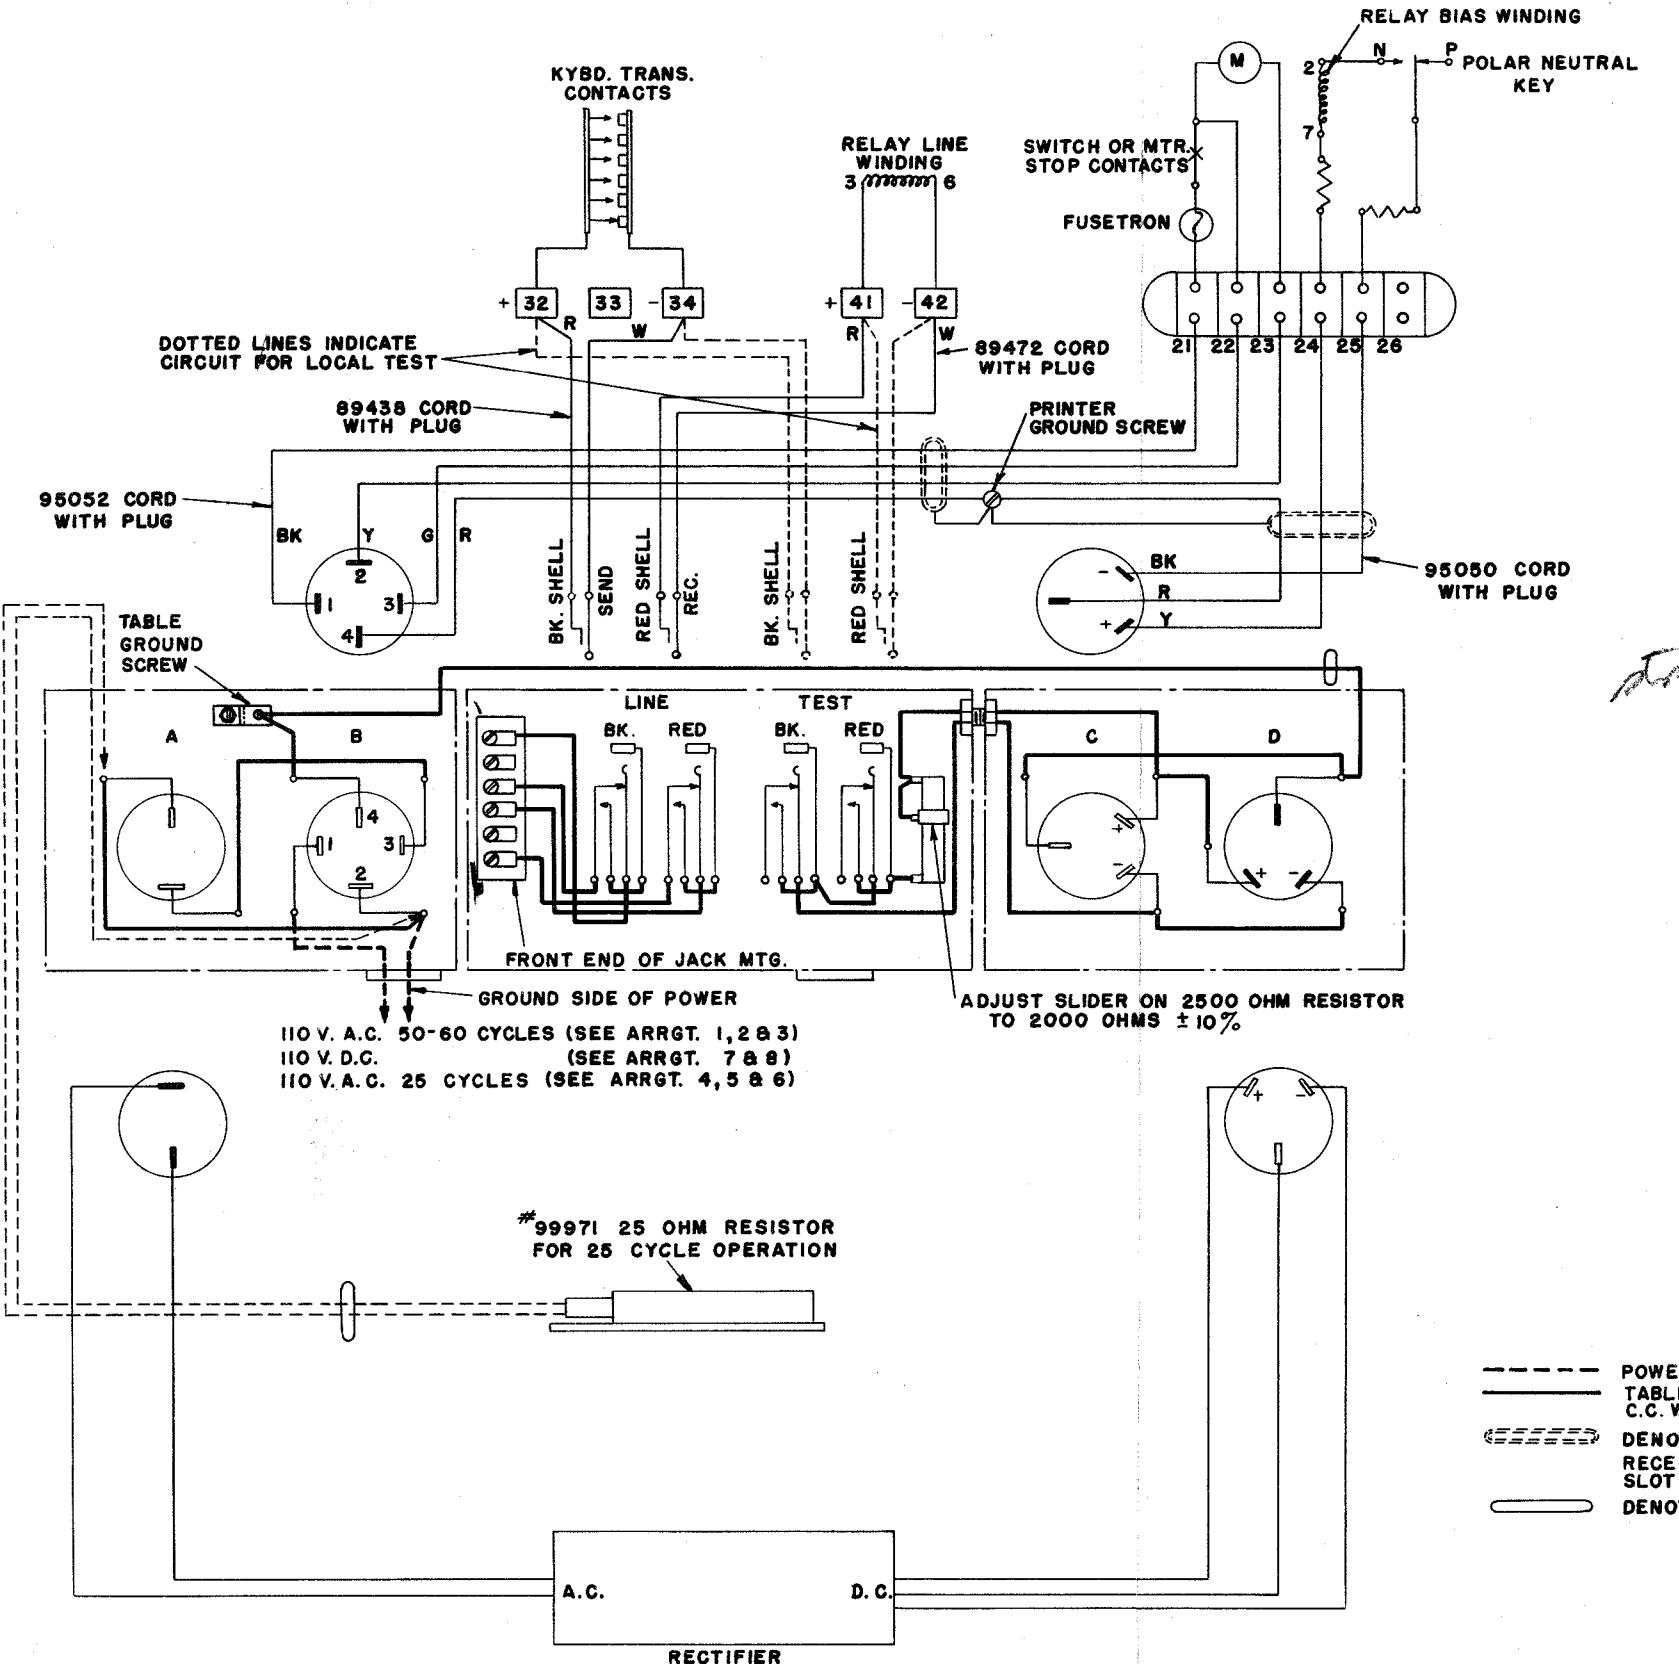

COLOR CODE
BK BLACK
Y YELLOW
R RED
G GREEN
W WHITE

POWER LEADS
TABLE WIRING - RM 31551 - 18 DELTABESTON
C.C. WIRE - BLACK
DENOTES SHIELDED CABLE
RECEPTACLES AND PLUGS SHOWN FROM
SLOT AND PRONG FACES
DENOTES WIRES IN BX

WIRING DIAGRAM
TABLE
FOR
15 PRINTER
XRT-106

DRAWN H.C.A.
TRACED J.J.F.
CHECKED G.A.M.
ENGRD. D.P.N.
APPROVED C.W.B.

REVISIONS
① NUMBERING REMOVED
FROM JACK MTG.
7-21-61 J.J.F.
② NOTES REGARDING
25 CYCLE OPERATION
ADDED.
8-22-61 G.A.M.

Tel.
+ 3
- 4
Dsp. 1 + 6

TELETYPE
CORPORATION
WD-2031
FEB. 14, 1941
WD 2031-B